

MODEL: A-RMB7 (B) Black A-RMB7 (W) White
Manual for Wall Mount Bracket for Remote Camera


Note: This unit is designed for installation of Remote Camera Max Weight 7kg (15.5 lbs) Only.
 Prior to installation, both camera's manual and this manual must be read and understood completely.
 Also prior to installation, check damage, defects, lack of accessories of this unit.
 Installation shall be done by the qualified installer only.
 Prior to installation, if questions arises regarding the installation, please consult and confirm with us.

STEP 1 Wall Mount (Mounting Screws/Bolts are not provided by us.)

Make sure that the mounting surface is capable of supporting the weight over 30kg(66 lbs).

φ 12mm x 4 Holes

Use 4 pcs of M6-10 bolts(or 1/4"-3/8")

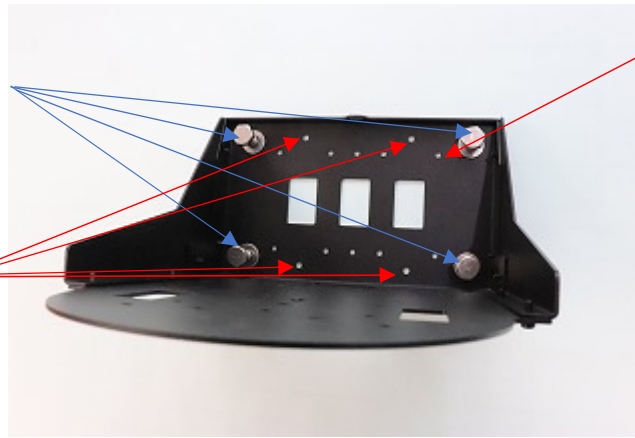

φ 5.5mm x 4 Holes


For 1 1/2" NPT Pipe Mount A-RMB7PM (Optional Item)

φ 4.5mm x 10 Holes


These 10 holes are for 46 x 83.5mm Pattern Gangbox. Use at least 8 pcs of M4(or 6-32) screws. **Do not use Gangbox as sole support.** Always use with other stronger screws by using φ 12mm or φ 5.5mm holes.

STEP 2 1 1/2"NPT Pipe Mount

Use of 1 1/2"NPT Pipe Mount Adapter Model A-RMB7PM(Optional Item)

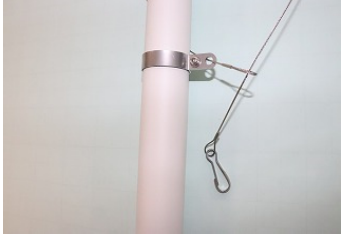

Install Safety Wire Clip first and then install Safety Wire.

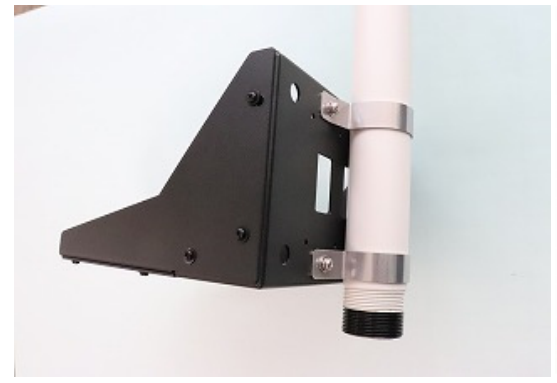


Install Brackets by M5 Phillips Head Bolts.


- Accessories** (For Camera) M4x12mm Phillips Head Screw, Hex Nut, Spring x 4pcs each, Washer x 8 pcs
 1/4-20x 3/8, 1/4-20x5/8 Bolts, 1/4 Washer x 2 pcs each
 (For Camera's Safety Wire) M3x12mm Sems, Hex Nut, Washer x 1 pc each (Safety Wire) A-SW1000L x 1 pc

STEP 3 Safety Wire

Install Safety Wire by M6-10 Bolt(1/4"-3/8")
 (Bolt is not provided.)

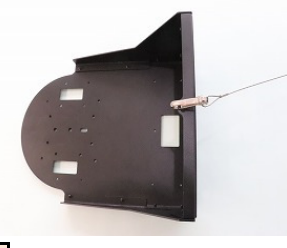

or



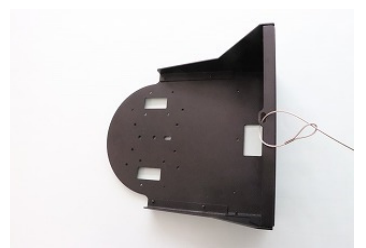


STEP 4 Install Camera

Note : Use Camera's Safety Wire if provided.

Example 1) Canon CR-N 5 0 0 Wall Bracket (UPRIGHT)

Take out Right Side Panel and install camera.

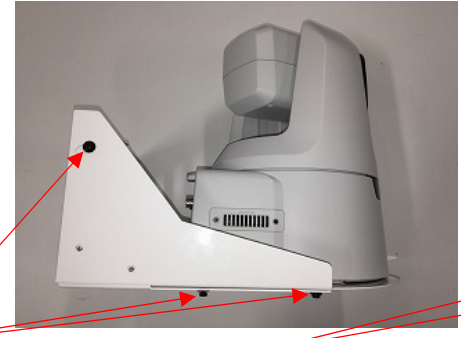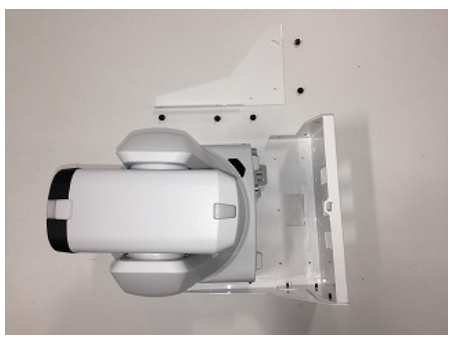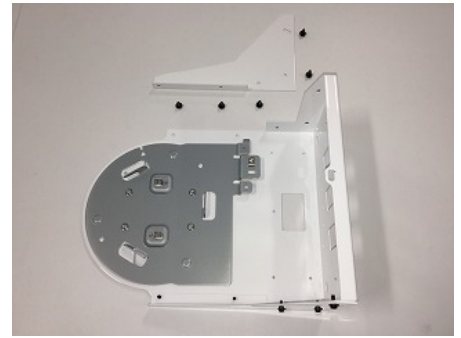

Fix **3 Screws** temporarily, check center of **2 Holes**, fix all 5 screws completely.

Example 2) Canon CR-N500 Bracket(INVERTED)

Example 3) 1/4-20UNC Screw Mount



Only Cameras

ASC Corporation
 3-16-9, Toranomom, Minato-ku, Tokyo, Japan
 TEL +81-3-5473-7627, FAX +81-3-5473-7628
 URL: <http://www.kk-asc.com>

ASC-USA, INC.
 5975 Shiloh Road, Suite 103
 Alpharetta, GA 30005, USA
 TEL 770-888-4674, FAX 770-888-4675